


Main Electrical Wiring for WB-10000

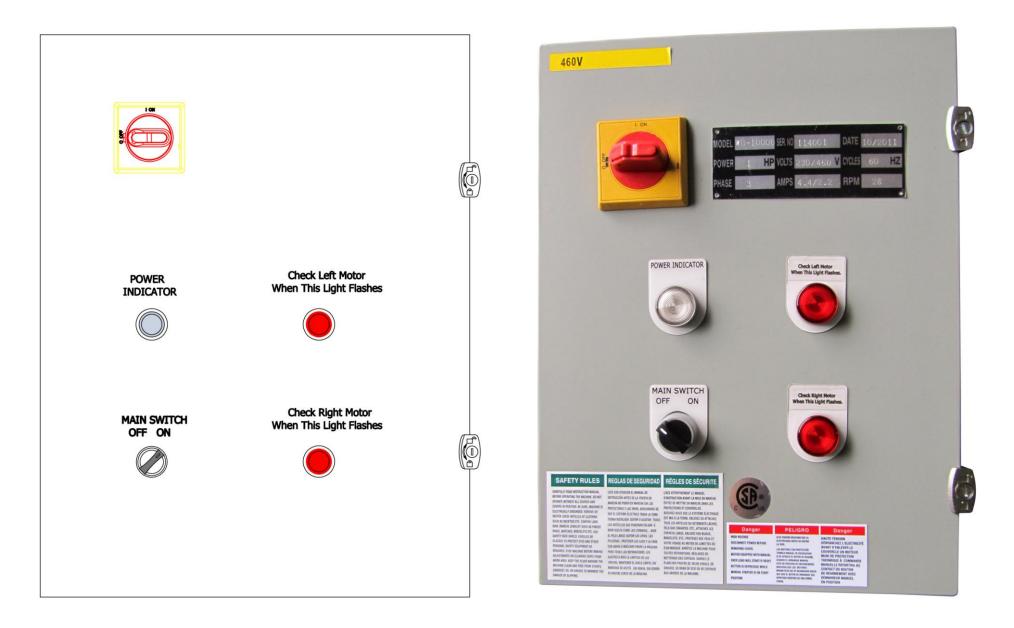

Main Electrical Wiring for WB-10000

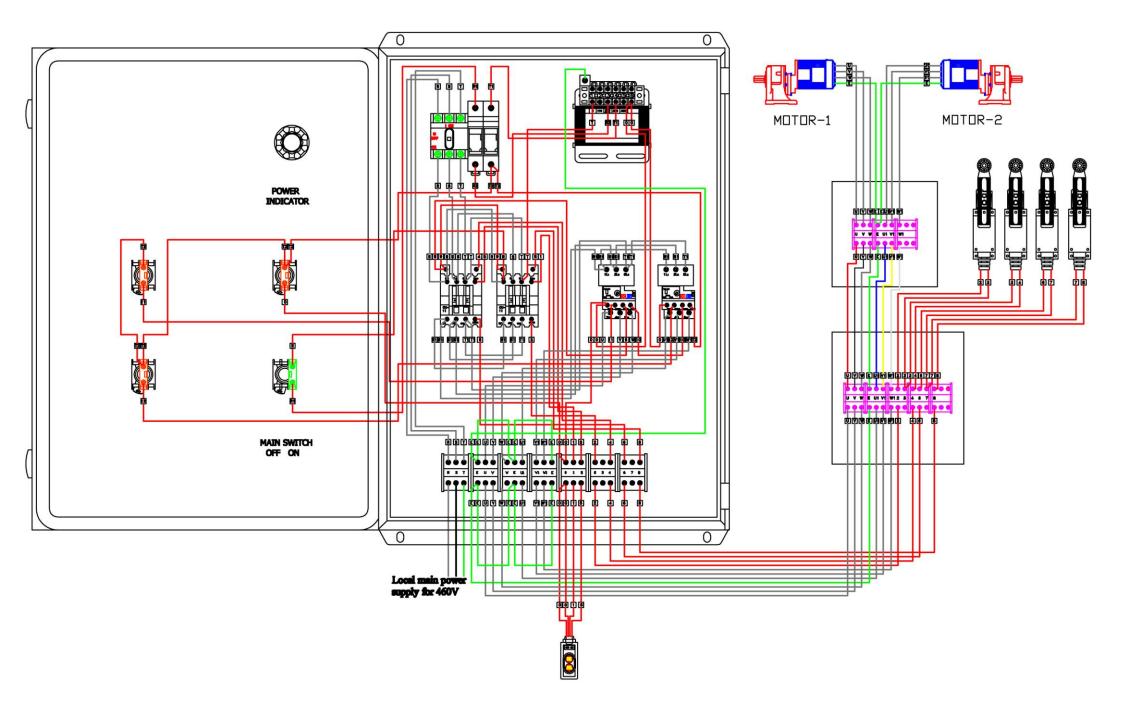

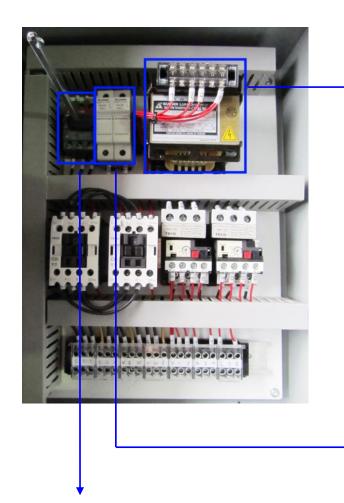

• Transformer for 460V.



Panel disconnect switch.






Fuse bus.





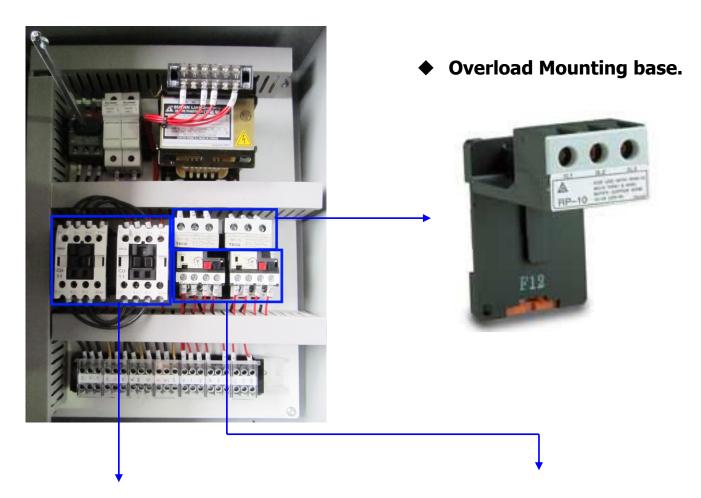



Magnetic contactor.




• Thermal Relay for motor of 1HP.



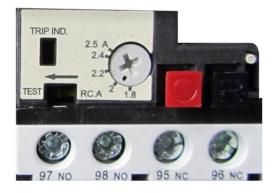

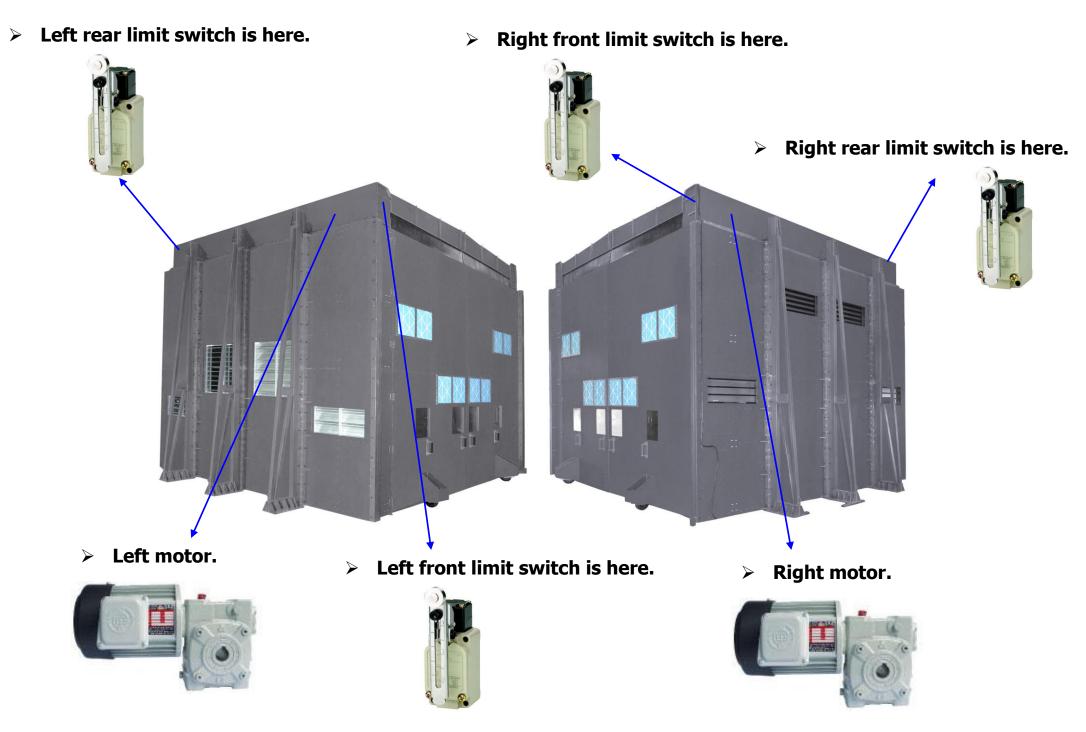

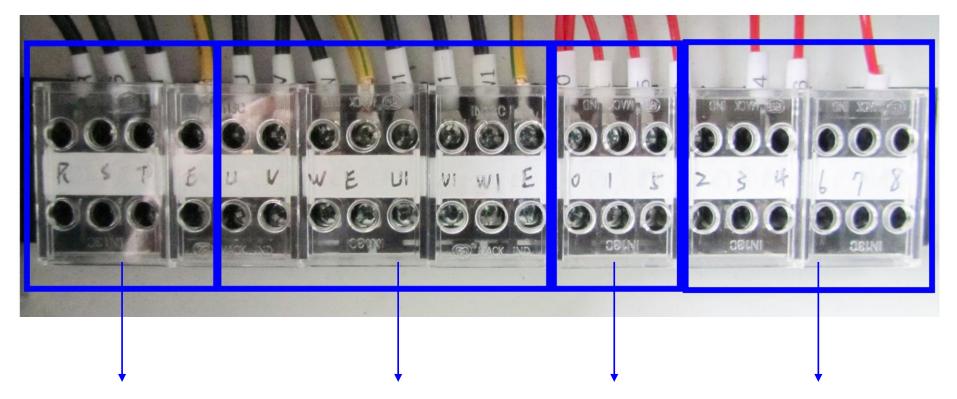

- Local main power supply for 460V.
- Connect to the electrical junction box for WB-10000.




 Connect to the complete pendant push button control for WB-10000.




 Connect to the electrical junction box for WB-10000.




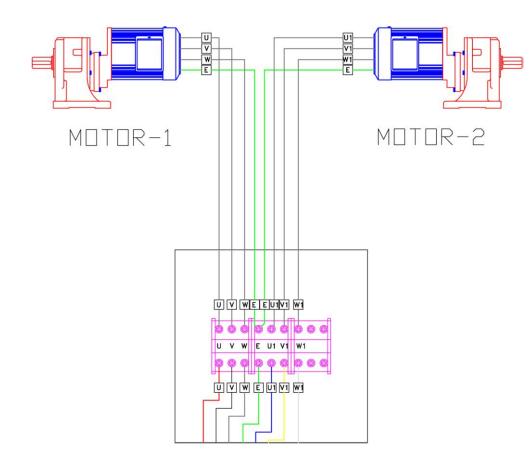


• Terminals connect to the motor.

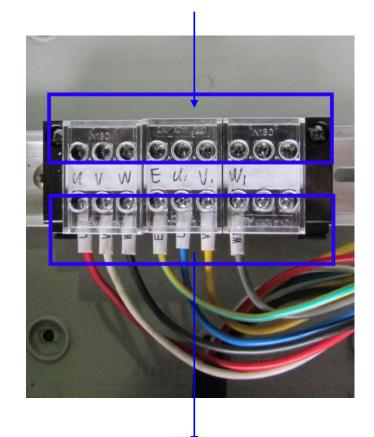


• Terminals connect to the electrical junction box.

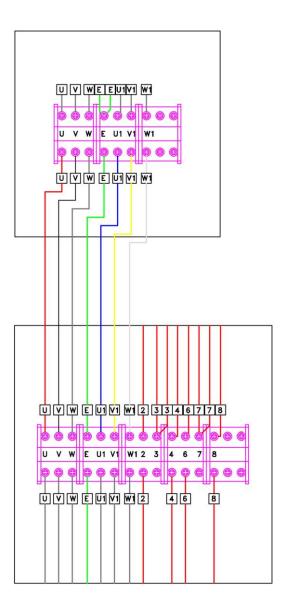


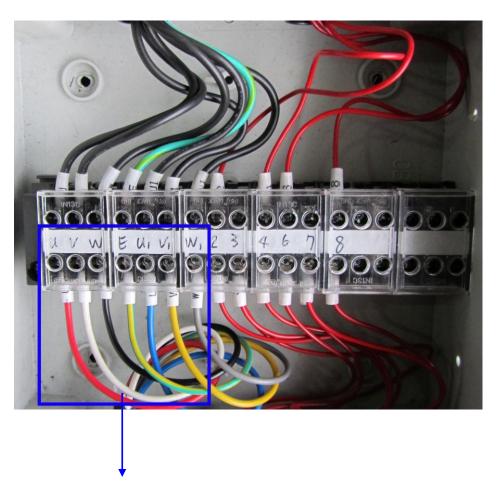

Terminals connect to the electrical junction box.

78

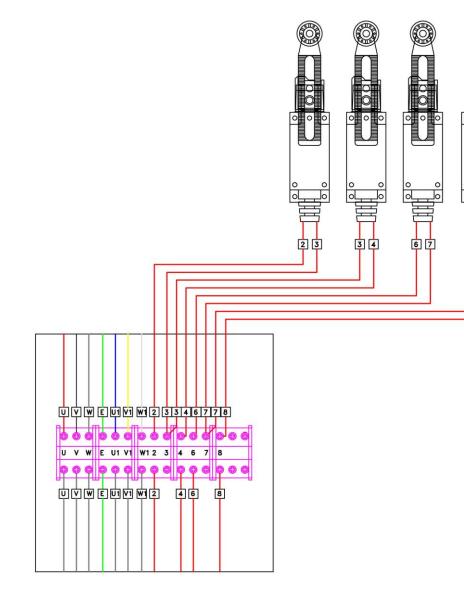

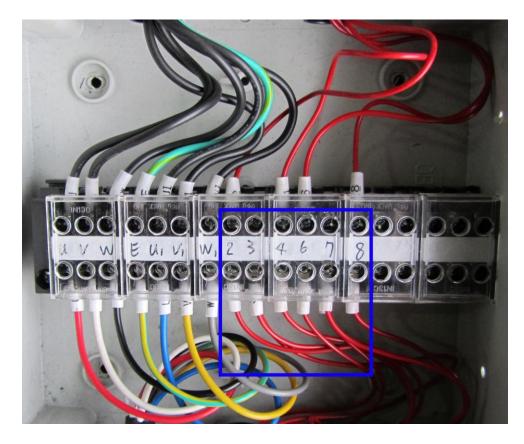

- ◆ 2 & 3 : The left front limit switch.
- ◆ 3 & 4 : The right front limit switch.
- ◆ 6 & 7 : The left rare limit switch.
- ◆ 7 & 8 : The right rare limit switch.



